

Vehicle Condition Report

Vehicle VIN: 46411057



Vehicle Information

Year : 1951 Mileage : 9119
 Brand : Buick Exterior Color : Beige
 Model : Special Automatic Trim Color : Gray
 Series : Limited Trim Type : Cloth
 Body Type : Sedan
 Drive Type : Rear Wheel Drive
 Engine : 4.0L, V8 Cylinder Engine, Gasoline Fuel
 Transmission : 4-Speed Automatic Transmission

Inspection Details

Inspection Date : 18 Sep 2012 4:25 PM
 Inspection ID : 48126
 Inspector : 4061

Grade : C

Inspection Notes : Vehicle is a 1951 Buick Special automatic. It has a flat head V8 246.9 cubic inch. Unverifiable Miles Due to 5 Digit Odometer. Overall it is a pretty solid old car with only minor issues. The hood has some surface rust, the weather stripping around the windows is cracked. It has a large oil leak coming from underneath the oil pan. The rear differential is also leaking. There are no rear seatbelts. The right rear quarter window is rotted out around the edges. It is all just normal wear from a car this old, nothing major or anything that can not be fixed. Strong motor, good brakes, and very quiet and comfortable. Odometer actually read 09119

Vehicle Accessories

Convenience Exterior

- Chrome Grille

Glass/Wipers/Lamps

- Lights, Fog

Mechanical

- Battery

Wheels

- ABS
- Aluminum Wheels
- Power Brakes
- Tires - Front Performance
- Tires - Rear Performance

Tire Information

	Manufacturer	Size	Depth		Manufacturer	Size	Depth
Left Front :	Other	225/75-15	6/32	Right Front :	Other	225/75-15	6/32
Left Rear :	Other	225/75-15	6/32	Right Rear :	Other	225/75-15	6/32
Spare :	Other	225/75-15	6/32	*Tire Depth of 5/32 or greater is considered normal			

Vehicle Condition

Wear and Tear

Area	Type	Size
1 Left Rear Quarter Panel	Dent No Paint Damage	Up to 1"
2 Trunk / Cargo Interior	Previous Repair	Bet 3" - 6"
3 Right Rear Door Glass corroded	Other / See Notation	Bet 3" - 6"
4 Hood Panel Rust	Other / See Notation	Bet 1" - 3 "

Vehicle Inspection Points

Legend: ● Item inspected and is ok ● Item inspected and contains an issue ○ Item is not present or could not be inspected

Engine Compartment

Emission Sticker	○	Check Engine Compartment for Fluid Leaks	●
Hood Struts Operation	○	Battery Is Secure	●
Underhood Insulation	●	Battery Condition	●
Hood Latch Operation	●	Check Transmission For Leaks	●

Engine Compartment-Parts and Fluid Levels

Windshield Washer Fluid Level	○	Check Power Steering Fluid Level	●
Inspect Hoses	●	Inspect Coolant Levels	●
Check For Engine Oil Sludge	●	Inspector Radiator Hose	●
Check Oil Level	●	Check Transmission Fluid	●
Inspect Belts	●	Check Master Cylinder For Brake Fluid	●

Exterior-Body Panels

Doors operate properly	●	Inspect Body Panels For Damage	●
Tailgate Operation	○	Inspect Roof for Damage	●
Inspect Undercarriage For Damage	●	Frame / Unibody	●
Inspect Truck Bed Condition	○	Check For Rust/ Corrosion	●

Notes: See Inspection Notes Section

Inspect Paint Condition	●	Emblem/ Badge	●
Inspect Windshield and Other Glass for Damage	●	Inspect Quarter Panels for Damage	●
Inspect Fenders for Damage	●	Door And Side Moldings	●
Trunk Lid Closes Flush With Quarter Panel	●	Inspect Bumpers and Molding For Damage	●

Exterior-Electronic

Side Markers	●	Side Marker Lights	●
Headlights - Low/ High Beam	●	Tail Lights	●
License Plate Lights And Brackets	●	Reverse Lights	●
Fog Lights	●	Brake Lights	●
High Center Third Brake Light	●		

Exterior-Hardware

Vehicle Identification Number On Door Jam	●	Vehicle Identification Number On Dashboard	○
Trunk Latch Functions	●	Convertible Top Operational	○
Front Wiper Blades	●	Side Mirrors	●
Remote Gas Cover Latch Operation	●	Gas Cap Condition	●
Door Handles Operational	●	Door Locks And Child Latches Function	●
Rear Window Windshield Wiper Arm	●	Antenna Mast Up/ Down	○
Rear Wiper Blades If Applicable	○	Side Mirror Extends	○

Chrome Parts



Roof Rack



Interior-Convenience and Power Controls

Remote Key Fob Functions



Power Seats



Alarm



Power Sunroof



Rear Window Sunshade



Window Switches



Window Operation



Power Mirrors



Manual Door Locks



Manual Windows



Power Door Locks



Power Windows



Interior-Heating and A/C

Cooled Seat Operation



Rear Defogger Grid Lines



Automatic Climate Control



Recirculating Air Mode



Heated Seat Operation



Vent Blower Speed



Air Conditioner Blows Cold Air



Heater Blows Warm Air



Notes: See Inspection Notes Section

Fresh Air Mode



Interior-Instruments / Controls

Emergency Road Hazard Lights



Rear Window Wiper Controls



Gearshift Operation



Horn Functions



Check Engine Light



Sunvisor Vanity Mirrors



Airbag Warning Light



Dome Light



Odometer Operation



Parking Brake



Rear View Mirror/ Compass Function



Sunvisor Lights Function



Tilt Steering Column Functions



Warning Lights, Other



Knobs, Buttons and Other Controls



Dashboard Illumination



Defogger Indicator Light



Dashboard Condition



Cupholder Extends



Clock Functions



Notes: Inoperable / Broken

Cigarette Ligher Operational



Battery Gauge / Warning Light



Hood Release



Trunk Release



ABS Warning Light



Windshield Wiper Controls



Interior-Radio / Entertainment

Rear Entertainment System and Controls



Rear Back-up Camera



Check Radio Controls



Speakers



Navigation System Operation



CD/DVD



Interior-Seating and Other Interior

Cargo Area Carpet



Airbag - Passenger



Vehicle Condition Report

Vehicle VIN: 46411057

Seating Surfaces - Rear	●	Carpet - Front	●
Headliner Condition	●	Smoker Residue Or Odors	●
Tire Jack and Tools	●	Owner's Manual	○
Seatbelts - Front	●	Seating Surfaces - Front	●
Seat Position Adjusters	●	Spare Tire	●
Trunk Light Operational	○	Weather Stripping Condition	●
		Notes: See Inspection Notes Section	
First Aid Kit If Applicable	○	Glove Box	●
Liftgate Struts	○	Toolkit Complete	●
Seatbelts - Rear	●	Windscreen Functionality, Convertible Top	○
Notes: Missing			
Door Sill Plates	●	Interior Trim	●
Tailgate Closing Assist	○	Armrest Condition	●
Headrests Function Properly	●	Airbag - Driver	○
Carpet - Rear	●		
Test Drive			
Cruise Control Operates	○	Steering Wheel Is Centered	●
Steering Wheel Operation	●	Cold/ Hot Starting	●
Engine Idling Normal	●	Engine Operating Temperature	●
Gears Range Operate Smoothly	●	Inspect For Brake Pulsation	●
Inspect For Excessive Smoke	●	Transmission/ Clutch Operation	●
Idle Smoothness	●	Speedometer Functions	●
Acceleration	●	Check For Squeaks	●
Check For Rattles	●	Check For Vibration	●
Excessive Wind Noise	●	Engine Noise	●
Suspension and Handling	●	Vehicle Tracks Straight	●
Starter Functionality	●	Check For Brake Noise	●
Inspect Backup Lights	●	Check For Unusual Tire Noise	●
Tires and Wheels			
Tire Condition and Tread Depth	●	Wheel Condition	●

Date : 18 Sep 2012

Signature : _____

V.4.1

Vehicle Condition Report

Vehicle VIN: 46411057

Vehicle Pictures


Picture Description : **Engine**



Picture Description : **Engine**



Picture Description : **Engine**

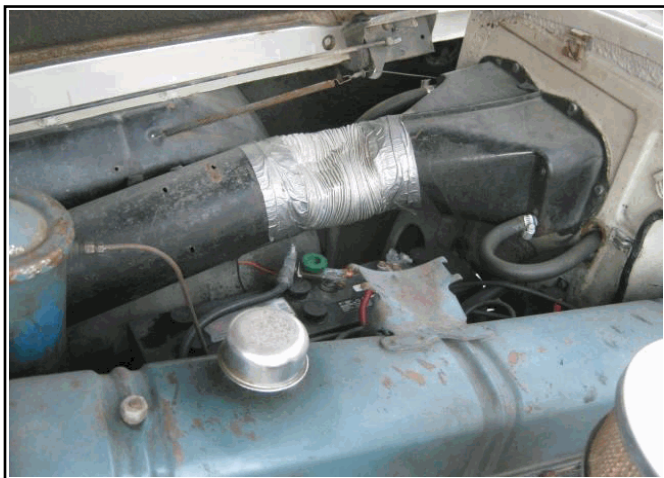

Picture Description : **Front**



Picture Description : **Front**



Picture Description : **Front Corner**



Vehicle Condition Report

Vehicle VIN: 46411057

Picture Description : **Tire**




Picture Description : **Roof**



Picture Description : **Left Side**



Picture Description : **Odometer**

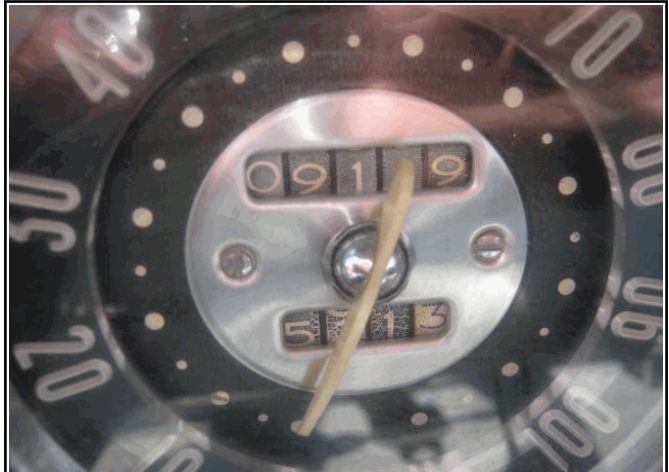

Picture Description : **Odometer**



Picture Description : **Interior**



Vehicle Condition Report

Vehicle VIN: 46411057

Picture Description : **Interior**



Picture Description : **Left Side**



Picture Description : **Interior**



Picture Description : **Tire**



Picture Description : **Int Cargo**



Picture Description : **Int Cargo**



Vehicle Condition Report

Vehicle VIN: 46411057

Picture Description : **Rear Corner**



Picture Description : **Rear**



Picture Description : **Rear Corner**



Picture Description : **Tire**



Picture Description : **Right Side**



Picture Description : **Right Side**



Vehicle Condition Report

Vehicle VIN: 46411057

Picture Description : **Tire**



Picture Description : **Interior**



Picture Description : **Key/CD/Manual**



Picture Description : **Right Side**



Picture Description : **Right Side**



Picture Description : **Right Side**



Vehicle Condition Report

Vehicle VIN: 46411057

Picture Description : **Vin**



Damage Pictures


Picture Description : **Quarter Panel Dent No Paint Damage Up to 1"**



Picture Description : **Trunk / Cargo Interior Previous Repair Bet 3" - 6"**



Picture Description : **Door Glass Other / See Notation Bet 3" - 6"**

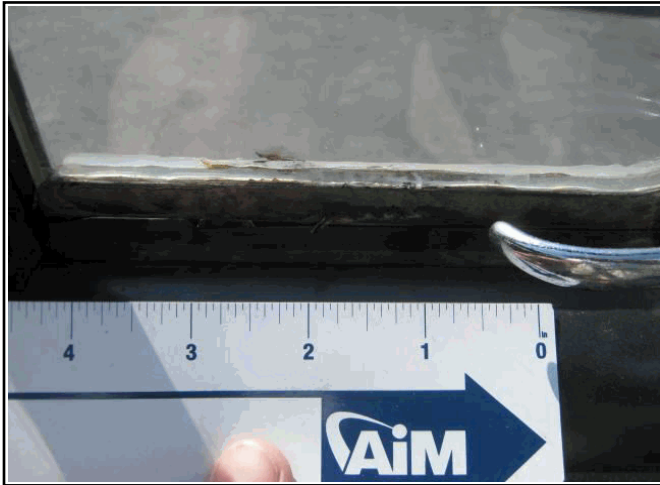

Picture Description : **Hood Panel Other / See Notation Bet 1" - 3"**



Picture Description : **Hood Panel Other / See Notation Bet 1" - 3"**

